

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch

690 Walnut Ave.St. 150

Vallejo, CA 94592-1133

(707) 649-5453

(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-014107**Date Inspected:** 31-Mar-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** You Qi Guo**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower Components**Summary of Items Observed:**

On this date Caltrans Office of Structural Materials Quality Assurance Inspector, Sandeep Kumar (QA) was present during the times noted above for observations relative to the work being performed.

Tower Trial Assembly

The following Non Destructive Testing (NDT) inspection carried out as per the ZPMC submitted Notification No. 005450

Visual Inspection Testing (VT)

This QA inspector performed VT of the area previously tested and accepted by ZPMC Quality Control personnel. The member is identified as Tower Component. The identified component and weld designations reviewed are as follows:

NORTH TOWER LIFT-1 SKIN'B' CAMERA MOUNTAIN PLATE

1. CAMPSA – 1 – 13~18

Magnetic Particle Testig (MT)

This QA inspector performed MT of approximately 15% of the area previously tested and accepted by ZPMC Quality Control personnel. This QA Inspector generated an MT report for this date. The member is identified as Tower Component. The weld designation reviewed as follows:

NORTH TOWER LIFT-1 SKIN'B' CAMERA MOUNTAIN PLATE - Green Tag# 11625

1. CAMPSA – 1 – 13~18

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

This QA Inspector observed the following work in progress:

Flux Core Arc Welding (FCAW):

Weld joint # 015 located on North Tower Lift-1 Bearing stiffener Plate NSD1 – SA76F/H. Welder is identified as 070397. ZPMC Quality Control (QC) Inspector is identified as Fu Wei Min. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2333 – Tc – P4 – F.
(See attached photo)

Weld joint # 003B located on West Tower Lift-1 Shear Plate at B/C corner outside WSD1 – A423A/H. Welder is identified as 040723. ZPMC Quality Control (QC) Inspector is identified as Zhu Yuan Yuan. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2233 – Tc – U5 – F.


Weld joint # 013 located on North Tower Lift-1 Bearing stiffener Plate NSD1 – SA11. Welder is identified as 068445. ZPMC Quality Control (QC) Inspector is identified as Fu Wei Min. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2333 – Tc – P4 – F.

Weld joint # 003B located on South Tower Lift-1 Shear Plate at B/C corner outside SSD1 – A111A/H. Welder is identified as 053316. ZPMC Quality Control (QC) Inspector is identified as Zhu Yuan Yuan. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2233 – Tc – U5 – F.

Weld joint # 011 located on North Tower Lift-1 Bearing stiffener Plate WSD1 – SA279. Welder is identified as 205649. ZPMC Quality Control (QC) Inspector is identified as Fu Wei Min. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2333 – Tc – P4 – F.

Weld joint # 001 located on West Tower Lift-1 Shear Plate at B/C corner outside WSD1 – A423A/H. Welder is identified as 219414. ZPMC Quality Control (QC) Inspector is identified as Zhu Yuan Yuan. The welding variables recorded by QC appeared to comply with the WPS – B – T – 2233 – Tc – P4 – F.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

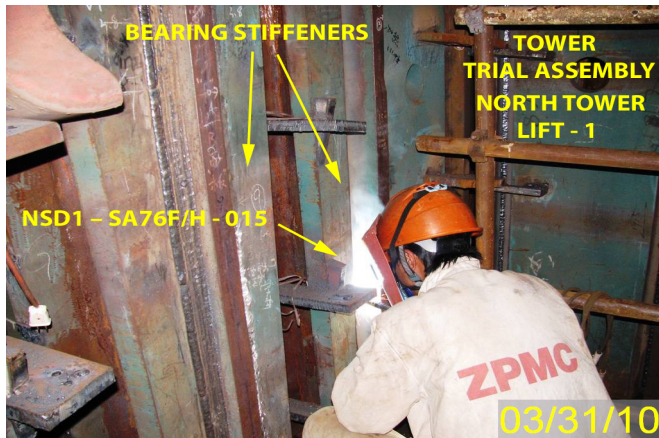

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Summary of Conversations:

No Relevant Conversations.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Skyler Guest - 15000422360, who represents the Office of Structural Materials for your project.

Inspected By:	Kumar,Sandeep	Quality Assurance Inspector
Reviewed By:	Clifford,William	QA Reviewer
